


Installation on flooring with an overall thickness of up to 19 mm (0.75").

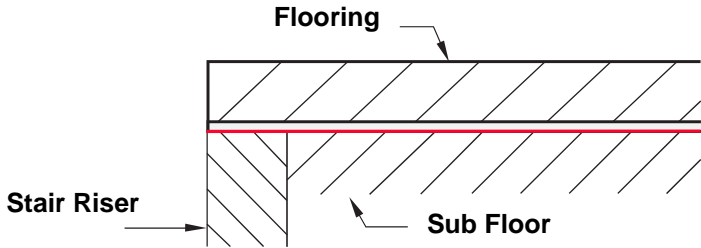



Step 1

Install the riser flush to the stair. Clean flooring and molding as directed below:

CLEANING PREPARATION FOR BOTH SURFACES

Preparing the floor and molding will significantly increase the quality of the bond

1. Use a damp cloth (water only) to clean both surfaces of loose particles or surface films.
2. Roughen the surfaces with sandpaper (100-150 grit), sanding sponge or metal brush. For flooring, only roughen up area that will be covered (1.25" to .5")
3. Degrease both surfaces to remove all traces of oil, grease and fingerprints by using a solvent such as methyl ethyl ketone (MEK), acetone or isopropyl alcohol.
4. Let both surfaces dry thoroughly before applying adhesive

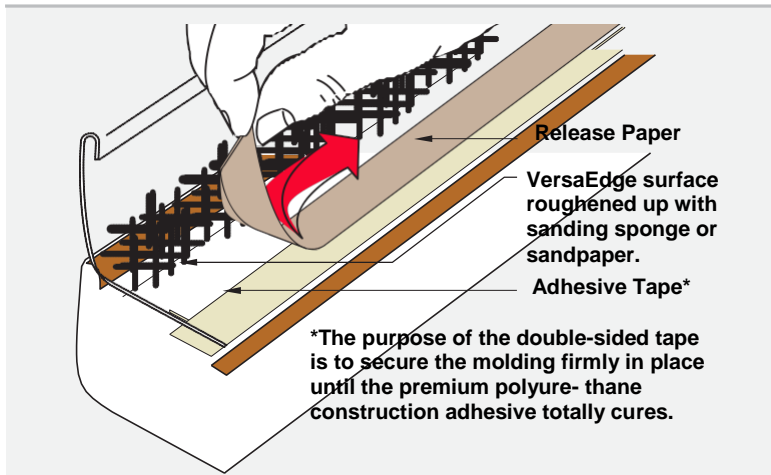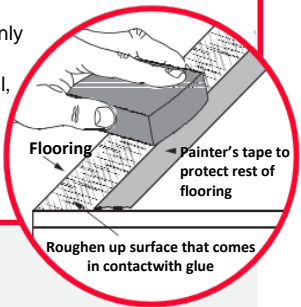


Step 2


Turn VersaEdge over and roughen the inside surface of the VersaEdge to increase bond by means of 60 grit sandpaper, sanding sponge, or a metal brush. Then, gently peel the release paper all the way off the adhesive tape.

Step 3


Next, apply a generous bead of a Premium Polyurethane Construction Adhesive along the entire inside corner. Be sure to overlap the tape with the adhesive.

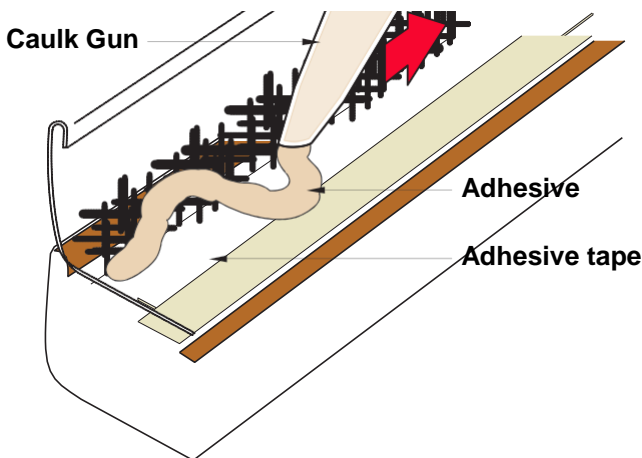

Underside of molding generously covered with adhesive

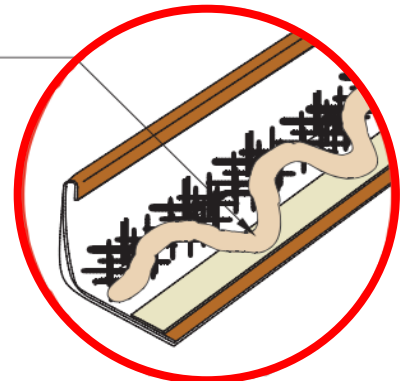


Installation on flooring with an overall thickness of up to 19 mm (0.75").

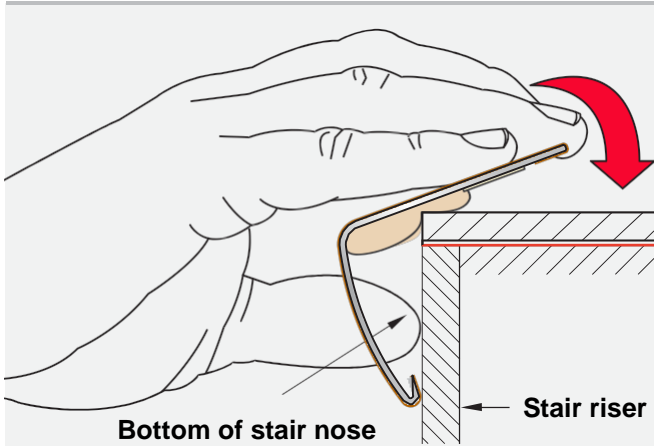

Step 4

Touch the bottom of molding to the stair riser and carefully roll the stair nose in place. Make any final adjustments before you push the molding all the way down. Once it's in the final position, press down firmly with your hands and make your way down the entire stair nose. It may take 2 or 3 passes to set it firmly in place.

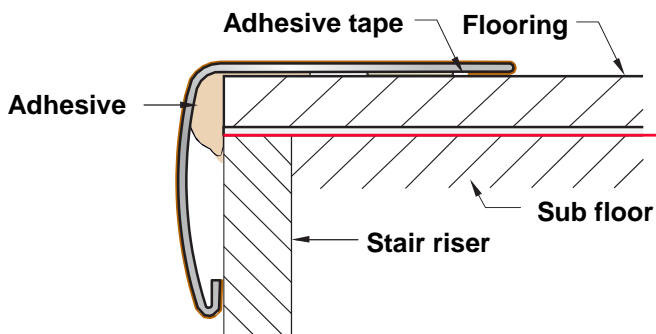

Step 5

For *Low traffic*, let the adhesive cure for at least 1 hour before walking on it. For *Heavy traffic*, wait 24 to 48 hours.

NOTE: Complete cure takes 48 hours.